CENTERS FOR MEDICAR STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULTIPLE CONSTRUCTION  A. BUILDING 01 - MAIN BUILDING 01		FORM APPROVI OMB NO. 0938-03 (X3) DATE SURVEY COMPLETED		
MANGE		445024	B. WING				
	OF PROVIDER OR SUPPLIER		<del></del>	STREET ADDRESS, CITY, STATE, ZIP COL	1 01	<u>6/23/2015</u>	
NHC HEALTHCARE, JOHNSON CITY				3209 BRISTOL HWY			
(X4) ID PREFIX	SUMMARY STATEMENT OF DEFICIENCIES		<del></del> _	JOHNSON CITY, TN 37601			
TAG		MUST BE PRECEDED BY FULL C IDENTIFYING INFORMATION)	PREFIX YAG	PROVIDER'S PLAN OF CORRI (EACH CORRECTIVE ACTION S) CROSS REFERENCED TO THE AP DEFICIENCY)	វិកាមា ១ ខេត	(X6) COMPLETIO DATE	
K 08: SS=I	NFPA 101 LIFE SAFETY CODE STANDARD  Required automatic sprinkler systems are continuously maintained in reliable operating condition and are inspected and tested periodically. 19.7.6, 4.6.12, NFPA 13, NFPA 25, 9.7.5		K 06	this inspection and the correct heads were on order. The correct sprinkler heads will be installed by East TN Sprinkler.  Other areas will be inspected by East TN Sprinkler to ensure no mixed-type			
	failed to ensure sprintypes.  The findings include:  Observation and interconfirmed the sprinkly pantry freezer were 1 type temperature ratio	rview on 6/23/15 at 8:47 AM er heads located in the -ordinary and 1-intermediate egs. (NFPA 13, 5-3,1.5.2) ed by the Maintenance		heads, and replaced as neces  East TN Sprinkler will be instructed for mixed-type heads duroutine maintenance.  Maintenance department will c sprinkler heads for correct instand report at the next QA meet	ucted to uring heck all	7/23/2015	
35=6		NEOUS	K 130				
	failed to ensure fire ba maintained. (NFPA 101 101, 8.3.5.1) The findings include: 1. Observation and int Maintenance Director.	i, 8.2.3.2.4.2. and (NFPA					

Any deficiency statement ending with an asterist (\*) denotes a deficiency which the institution may be excused from correcting providing it is determined that following the date of survey whether or not a plan of correction is provided. For nursing homes, the findings stated above are disclosable 90 days days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued

DEPARTMENT OF HEALTH AND HUMAN SERVICES
CENTERS FOR MEDICARE & MEDICAID SERVICES

PRINTED: 06/25/2015 FORM APPROVED OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION  NAME OF PROVIDER OR SUPPLIES	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 445024	A. BUILO		(X3) DA	TE SURVEY	
NAME OF PROVIDED OR SUPPLIES	445024	l	(X2) MULTIPLE CONSTRUCTION A. BUILDING 01 - MAIN BUILDING 01		(X3) DATE SURVEY COMPLETED	
I NAME OF PROVINED AS CHARLIES		B. WING		0.0	08193/3645	
		STREET ADDRESS, CITY, STATE, ZIP CODE 3209 BRISTOL HWY JOHNSON CITY, TN 37601				
MACHA I REACH DEFICIENC	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETION DATE	
confirmed numero penetrations by du other penetrations by du other penetrating if 1-hour attic floor so The penetrations was material and no Utused.  2. Observation and Maintenance Direct confirmed unsealed doors to compartmoffice.  3. Observation and Maintenance Direct confirmed combust through openings a separating the faciliside and the Station 1-11.2.3)  4. Observation and Maintenance Direct confirmed the 3-hour to close to a positive 5. Observation and Maintenance Direct confirmed the Static to a positive latch. (These findings were Supervisor and ack	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)  COntinued From page 1 confirmed numerous improperly sealed penetrations by ductwork, sprinkler piping and other penetrating items in the lightweight concrete 1-hour attic floor separation to the floor below. The penetrations were filled with a rock-like material and no UL listed firestop system was used.  2. Observation and interview with the Maintenance Director, on 6/23/2015 at 12:40 PM confirmed unsealed wiring sleeve above the fire doors to compartment #5 next to the "RCC-3" office.  3. Observation and interview with the Maintenance Director, on 6/23/2015 at 11:15 AM confirmed combustible floor coverings extended through openings at the 3-hour fire doors separating the facility to the independent living side and the Station 4 fire wall. (NFPA80, 1-11.2.3)  4. Observation and interview with the Maintenance Director, on 6/23/2015 at 10:26 AM confirmed the 3-hour fire door by room 201 failed to close to a positive latch.  5. Observation and interview with the Maintenance Director, on 6/23/2015 at 10:26 AM confirmed the Station 2 pantry door failed to close to a positive latch. (NFPA 101, 19.3.2.1 (7). These findings were verified by the Maintenance Supervisor and acknowledged by the Administrator during the exit conference on		Identified penetrations will be a sealed. Identified floor covering properly trimmed. Identified do be adjusted for positive-latch of Pride Fire Protection has ident penetrations and presented to for proper penetration recipe to problem.  The maintenance department of fire barriers for proper installating function during their routine mainspections and after any subcovers; they will develop a system formal notification to inform any subcontractor of the necessary barrier standards before any waround the fire barriers is initiated staff will be in-serviced at next meeting to immediately notify maintenance department if any closing to a positive latch.  The maintenance department was perform routine inspections of financial barriers and report results to the committee on a quarterly basis.	gs will be ors will osure. fied the engineers correct will inspect on and othly intractor of fire rk to ored. All taff door fails QA	7/23/2015	